


AUTOMATE WIRFREE S35 MOTOR

HOW TO CORRECTLY CHARGE YOUR MOTOR

STEP 1

Plug charger into motor


A green light will appear, this confirms connection is made between motor & charger.

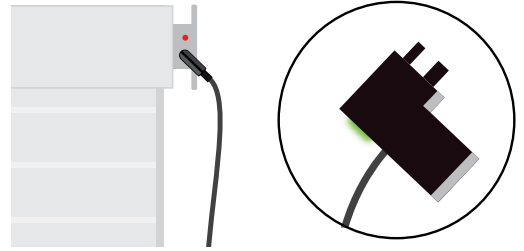

STEP 2

Plug charger into power point.


Note: Light on charger remains green

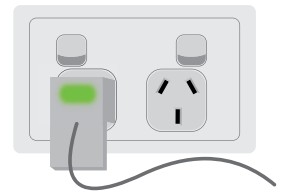

STEP 3

Turn power ON


Note: Light on charger turns red (this indicates motor is charging)

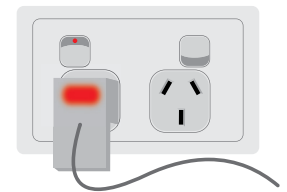

STEP 4

Leave on charge for 3 hours.

Light should be green before proceeding to Step 5.

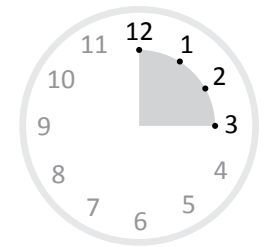

STEP 5

Turn power OFF and remove charger from power point & motor.

